

This document is provided to IBM and our Business Partners to help sell and/or service IBM products. It is not to be distributed beyond the

IBM PC - Pentium Overdrive (P24T) does not work

Applicable to: **World-Wide**

Service Information

The Pentium Overdrive (P24T) processor will not work in early PC-300 systems due to a level-2 cache signalling incompatibility.

There are *four* possible solutions. In all cases Flash BIOS 60 or later is also required. To obtain this please click [here](#)

- 1) Obtain the latest revision system board. This can be identified by the absence of component R6 near to the front right hand corner of the board and FRU labels 96G2949 + 95G9496.
- 2) Obtain a special interposer from IBM. The manufacturing part number for the interposer is 89G4125, - availability ordering procedures are yet to be announced..
- 3) Obtain an interposer from Intel Corp. (Critical situations ONLY).
- 4) Remove the pin indicated below from the Pentium Overdrive.. (Not recommended)

