



IBM Dealer Confidential

GSMH-39MKQF

Doc Size 1.623 bytes

Service Hints & Tips

IBM PS/2 - Video Twitch in 76i/77i

Symptom:

Top inch of screen image, extending inward from either left or right edge for 2-2.5 inches twitches at around 1Hz.

Problem Isolation Aids:

Check that BIOS Revision Level [04] v3.03 plus updated XVAVESA.COM are applied. Problem occurs with latest BIOS and XVAVESA.COM levels.

Fix:

Failure caused by tolerance problem with specific planar NVRAM component. New planars with revised NVRAM level have been released. To address current field failure situations, fixed planars are available against new FRU numbers.

96G1305 - 25MHz planar.

96G1306 - 33MHz planar.

Current Greenock manufacturing build level is based upon the fixed planar level.

Document Information:

Search Keywords

Hint Category	Video
Date Created	13.09.95
Last Updated	08.05.98
Revision Date	30.04.99
Brand	IBM PC
Product Family	PS/2
Machine Type	9576i, 9577i
Model	
TypeModel	
Retain Tip (if applicable)	N/A
Reverse Doclinks and Admin Purposes	